

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section 29, Township 115 N., Range 41 W., 5th P.M.

STATE OF MINNESOTA, County of YELLOW MEDICINE

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 9-25-84 placed a 1 1/4" x 1 1/4" x 20" PERFORATED STEEL TUBE WITH
DATE ALUMINUM CAP STAMPED "DNR SURVEY MARKER", DOWN 0.3'

SKETCH OF REFERENCE TIES

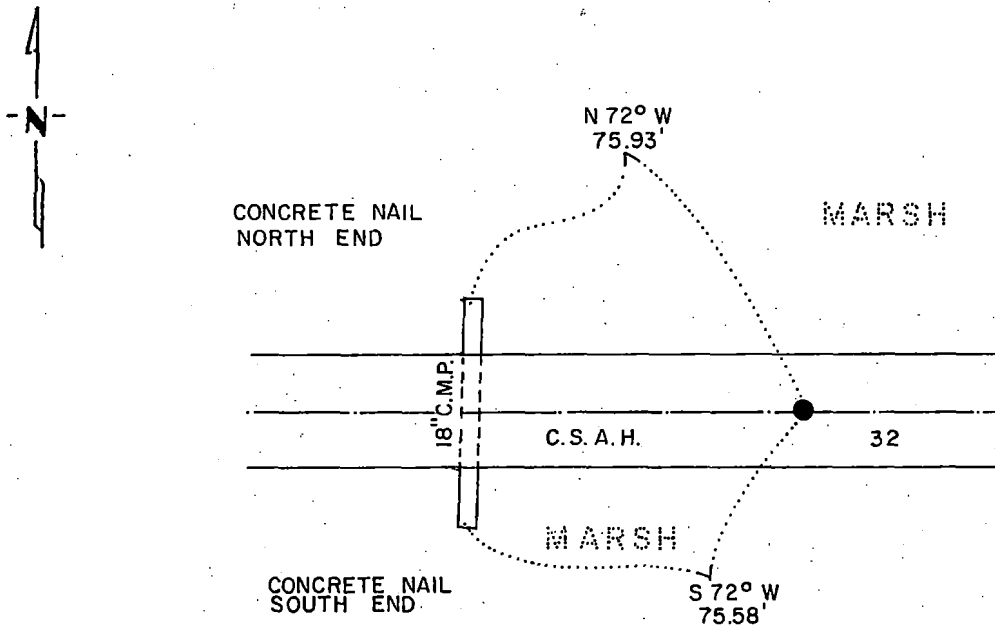

NOTE:
MONUMENT IS
1.0' NORTH OF E
E-W RD.

BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page.

J.A.G. 10-2-84
G-835

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

John D. Walker 11-8-84
SIGNATURE DATE

Registration No. 16098
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
County of Yellow Medicine

I hereby certify that this document was filed in the Co. Recorders office at 9:50 A.M. on the 15 day of November A.D., 19 84

County Recorder Sumner J. Opdahl

By _____, Deputy

DOCUMENT NO. 185093

RECORDED ✓
GRANTOR ✓
GRANTEE ✓
INDEXED ✓

North Quarter Corner Section 29, Township 115 North, Range 41 West

This corner was originally established by the U. S. General Land Office in 1864. The government notes show the corner is in a lake with a witness corner set 5.43 chains (358.38 feet) East and marked with a wood post in mound of earth with pits and trench dug around the mound.

In May 1984, the DNR Bureau of Engineering contacted the Yellow Medicine County Offices of the Recorder and Highway Engineer for corner information.

The following information was obtained from the County Recorder's Office:
Surveyor's Record Book, on Page 74, contains a survey made by Jonah Peterman, County Surveyor, in December 1889. Survey states that this corner was not found. A distance of 79.74 chains (5262.84 feet), GLO measurement, is shown along the north line of Section 29. Corner was established in a slough, midway and on line between the section corners. The witness corner is shown 5.30 chains East of corner. Survey does not mention what was set at quarter corner or what was found at witness corner.

The following information was obtained from the D.N.R. Bureau of Engineering Records:

In December 1961, the corner was assumed on line between section corners and in line with a crop line and fence line south. Corner is shown:

2667.0 feet from the northeast corner of Section 29

2619.0 feet from the northwest corner of Section 29

Survey does not indicate what was set to mark this location, and no information is given on the witness corner.

On May 31, 1984, the DNR Bureau of Engineering traversed to the area of the corner and located the intersection of the center line of an east-west road and a vague field division about 1000 feet south.

On June 7, 1984, the D.N.R. Bureau of Engineering dug a hole ten feet east-west by five feet north-south the center being at the intersection of the center line of road and field division. At a depth of 68 inches encountered a layer of black dirt under which was a layer of rocks throughout entire hole. Rocks appear to have been placed as a base for road. Stopped digging as these rocks were at natural ground.

Did not search for evidence of witness corner because no record of its perpetuation could be found. Computed the lost position for corner and found it to be:

2642.36 feet from section corners

2.37 feet north and 23.38 feet east of the intersection of road and field division

Did not dig for a monument at the lost position because no record of a monument being set could be found.

Accept the lost position as the location of the original government corner.

Traverse information is available from the DNR Bureau of Engineering.