

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 24, Township 113 N., Range 39 W., 5th P.M.

STATE OF MINNESOTA, County of YELLOW MEDICINE

At the corner location shown on the sketch:

■ On 7/11/89 found a 60d SPIKE, FLUSH  
DATE


left monument as found,  lowered monument,  removed monument (explain)

■ On 7/11/89 Placed a 1 1/4" X 1 1/4" X 20" PERFORATED STEEL TUBE WITH  
DATE ALUMINUM CAP STAMPED "DNR SURVEY MARKER", DOWN 0.5'

### SKETCH OF REFERENCE TIES



NOTE:  
PLACED 3/4" X 24" IRON ROD  
INSIDE MONUMENT DOWN 0.5'  
MONUMENT IS  
5.5' WEST TRANSIENT BALK

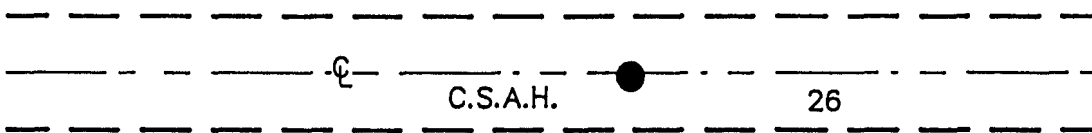

TIES NOT AVAILABLE

Statement of evidence relative to this corner location is on back of page.

7/25/89  
G-225

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Lawell R. Pomeroy Jr. 8-2-89  
SIGNATURE DATE

Registration No. 17005

Land Surveyor,  Professional Engineer  
 County Surveyor,  County Engineer

OFFICE OF THE COUNTY RECORDER  
County of Yellow Medicine

I hereby certify that this document was filed in the Co. recorders office at 11:15 A.M. on the 4 day of August A.D., 1989

County Recorder Norm J. Godwin  
By \_\_\_\_\_, Deputy

DOCUMENT NO. 195719

North Quarter Corner Section 24, Township 113 North, Range 39 West

The DNR Bureau of Engineering contacted the following offices for information on this corner:

MN Secretary of State  
Yellow Medicine County Recorder and Highway Engineer  
Moseng Land Surveying at Marshall  
KBM at Redwood Falls

- 1864 The U.S. General Land Office notes in the Secretary of State's Office show a post set in a mound for the corner.
- 1901 Surveyor's Record Book B, from the County Recorder's Office, contains a collection of what was found at government section corners by John Norgaard, County Surveyor, in a township re-monumentation survey. Norgaard states, on page 219, the northeast corner of Section 23 was set equal distance from this corner, a quarter post, and the other adjoining quarter corners.
- 1965 A government corner tie book, from the County Highway Engineer's Office, shows this corner was assumed. Three reference ties are shown. From highway stationing, this corner measures:  
2658 ft. from the northeast corner Section 24  
2658.6 ft. from the northeast corner Section 23
- 1989 July 11, the DNR Bureau of Engineering hired a backhoe operated by Wyatt Bendix of Echo to dig for evidence of this corner. Found a 60d spike at the surface on the center line of an east-west road, in line with a fence north. Dug a 5 ft. north-south by 10 ft. east-west hole to a depth of 4 feet, but found nothing. Area of corner appears to be in a cut section of road. Intersection of road and fence, mentioned previously, was found to measure:  
2656.56 ft. from the northeast corner Section 24  
2658.03 ft. from the northeast corner Section 23  
Discarded the spike and set a DNR Survey Marker and 3/4" by 24" iron rod within down 0.5 ft. at above mentioned intersection.

Analysis of the available information led the DNR Bureau of Engineering to conclude that the above mentioned intersection of road and fence marks the location of the corner.