

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

# 6 MEANDER Corner of Section 30, Township 115 N, Range 30 W, 5th P.M.

STATE OF MINNESOTA, County of YELLOW MEDICINE


At the corner location shown on the sketch:

- On \_\_\_\_\_ found a \_\_\_\_\_  
DATE
- left monument as found,       lowered monument,       removed monument (explain)
- On \_\_\_\_\_ Placed a \_\_\_\_\_  
DATE

### SKETCH OF REFERENCE TIES



NOTE:  
NO MONUMENT SET  
AREA OF CORNER IS IN  
THE MINNESOTA RIVER  
(6-14-95)

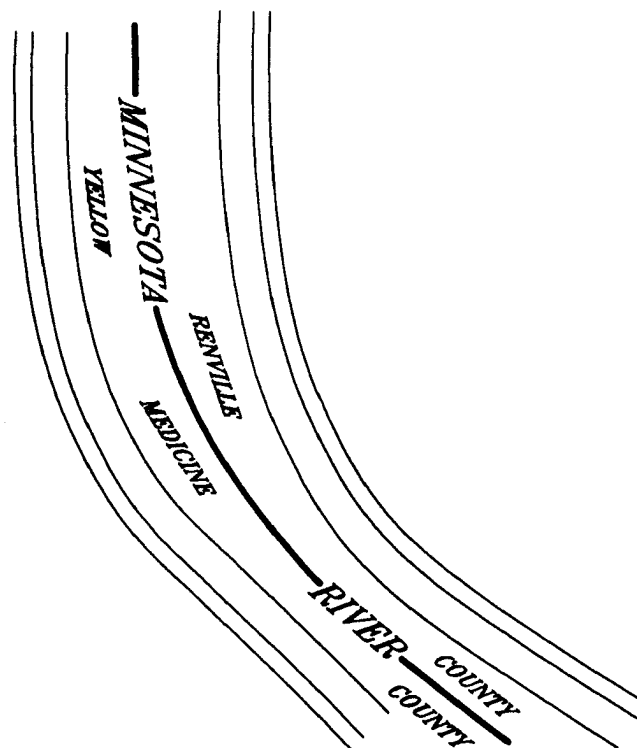

Statement of evidence relative to this corner location is on back of page.

JBM OCT '95  
SPK.00277.00.00.01

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Bruce W. Sheppard      11/6/95  
SIGNATURE      DATE

License Number 17003

- Land Surveyor,       Professional Engineer
- County Surveyor,       County Engineer

OFFICE OF THE COUNTY RECORDER  
County of Yellow Medicine

I hereby certify that this document was filed in the Co. recorders office at 10:35 A .M. on the 7 day of November A.D., 1995

County Recorder Doreen A. Spickard  
By \_\_\_\_\_, Deputy

DOCUMENT NO. 210279

Meander Corner Number 6 Section 30, Township 115 North, Range 38 West

The DNR Bureau of Engineering contacted the following for survey information:

Minnesota Secretary of State's Office  
Mn/DOT Offices in St. Paul and Willmar  
Yellow Medicine County Recorder's Office  
Yellow Medicine County Highway Engineer's Office  
Montevideo City Engineer's Office  
Bonnema Surveys of Willmar  
Moseng and Zieske Surveying, Inc. of Marshall  
Michael Nyberg, RLS #13145, of Carlos  
West Central Land Services, Inc. of Willmar  
K.B. MacKichan and Associates, Inc. of Redwood Falls

- 1864 U.S. General Land Office notes obtained from the Secretary of State's Office show the corner marked with a wood post in a mound of earth with pits on the right bank of the Minnesota River. The corner is shown:  
31.26 chains (2063.16 feet) from the east quarter corner of Section 30  
The notes show that a distance north of corner was not measured.
- 1866 U.S. General Land Office notes for the subdivision of Township 115 North, Range 38 West that lies north of the Minnesota River, obtained from the Secretary of State's Office show that the wood post that was set in 1864 was found at corner. The corner is shown:  
South  $34 \frac{1}{2}^{\circ}$  East, 6.75 chains (445.50 feet) from Meander Corner Number 5
- 1977 May, a Certificate of Survey in the northeast quarter of Section 30 and in the east half of Section 19 obtained from West Central Land Services, Inc. shows that an iron pipe was set on the east line of Section 30 and 14 feet south of the Minnesota River. No information is given about the meander corner. The iron pipe is shown:  
A) 1958.42 feet from the east quarter corner of Section 30  
B) on the northerly extension of a line from the southeast corner of Section 30 thru the east quarter corner of Section 30  
C) 897.58 feet north of an iron pipe set on the east line of Section 30
- 1989 November 2, DNR Bureau of Engineering searched for the iron pipe set on the right bank of the Minnesota River and found that the river has moved south and removed the iron pipe. Also, searched 898 feet south for the iron pipe set on the east line of Section 30 but did not find it.
- 1995 June, DNR Bureau of Engineering computed a position for corner as follows:  
A) 2063.16 feet (GLO distance) from the east quarter corner of Section 30  
B) on the northerly extension of a line from the southeast corner of Section 30 thru the east quarter corner of Section 30

Analysis of the above information led the DNR Bureau of Engineering to conclude that the computed position for corner - GLO distance from the east quarter corner of Section 30 and on the northerly extension of a line from the southeast corner of Section 30 thru the east quarter corner of Section 30 - marks the location of corner. Could not set a monument for corner because its location is in the Minnesota River and did not set a reference monument to corner because area is in the flood plain..